

SITE REPORT

Level 1, 153 Thorndon Quay, Wellington 6011
tel: 64 4 4738361
email: pietro.dinicola@silvesterclark.co.nz



Job:	190 High Street Review of Seismic Strengthening	Job No:	22815
Issued To:	James Sillay	Date / Time:	27/01/2020 2:00 pm
		Weather:	Overcast
Email cc to:	Ada Huang	Site contact:	James Sillay
Drawing Reference:	SK1, SK2, SK3, SK4, SK5, SK6	Site Report:	#01

Purpose of inspection

- Inspection of newly installed steelwork.

Observations/Comments

- All of the additional steel has been put in place, with some of the welds yet to be completed.
- Wall connections need also to be completed. Some of the top holes on the 250UB extension were drilled in correspondence of the column taper. In such cases it is recommended to weld a 6mm plate to the flange 100mm lower than the existing hole so that the concrete anchor can be installed with sufficient edge distance.
- It is recommended that dry pack is added at the interface between anchors and 250UB flange.
- Column C-4 to C-6. Contrarily to what discussed on site, it is suggested adding stiffeners in correspondence to the column extension flanges – refer to SK6 Rev.B. It is acceptable to extend the existing stiffeners when feasible. The drainage pipe will need to be temporarily removed to install the stiffeners on the wall side.

Contractor to provide

- Remedials as indicated above.

Next anticipated inspection

- TBA

Photos



Photo 1 – Column A-2. Bottom connection



Photo 2 – Column A-2. Top connection



Photo 3 – Column C-2.



Photo 4 – Column C-2. Top connection



Photo 5 – Column C-3. Bottom connection



Photo 6 – Column C-3. Top connection




Photo 7 – Column C-4.



Photo 8 – Column A-3.

Columns C-4 to C-6

NTS

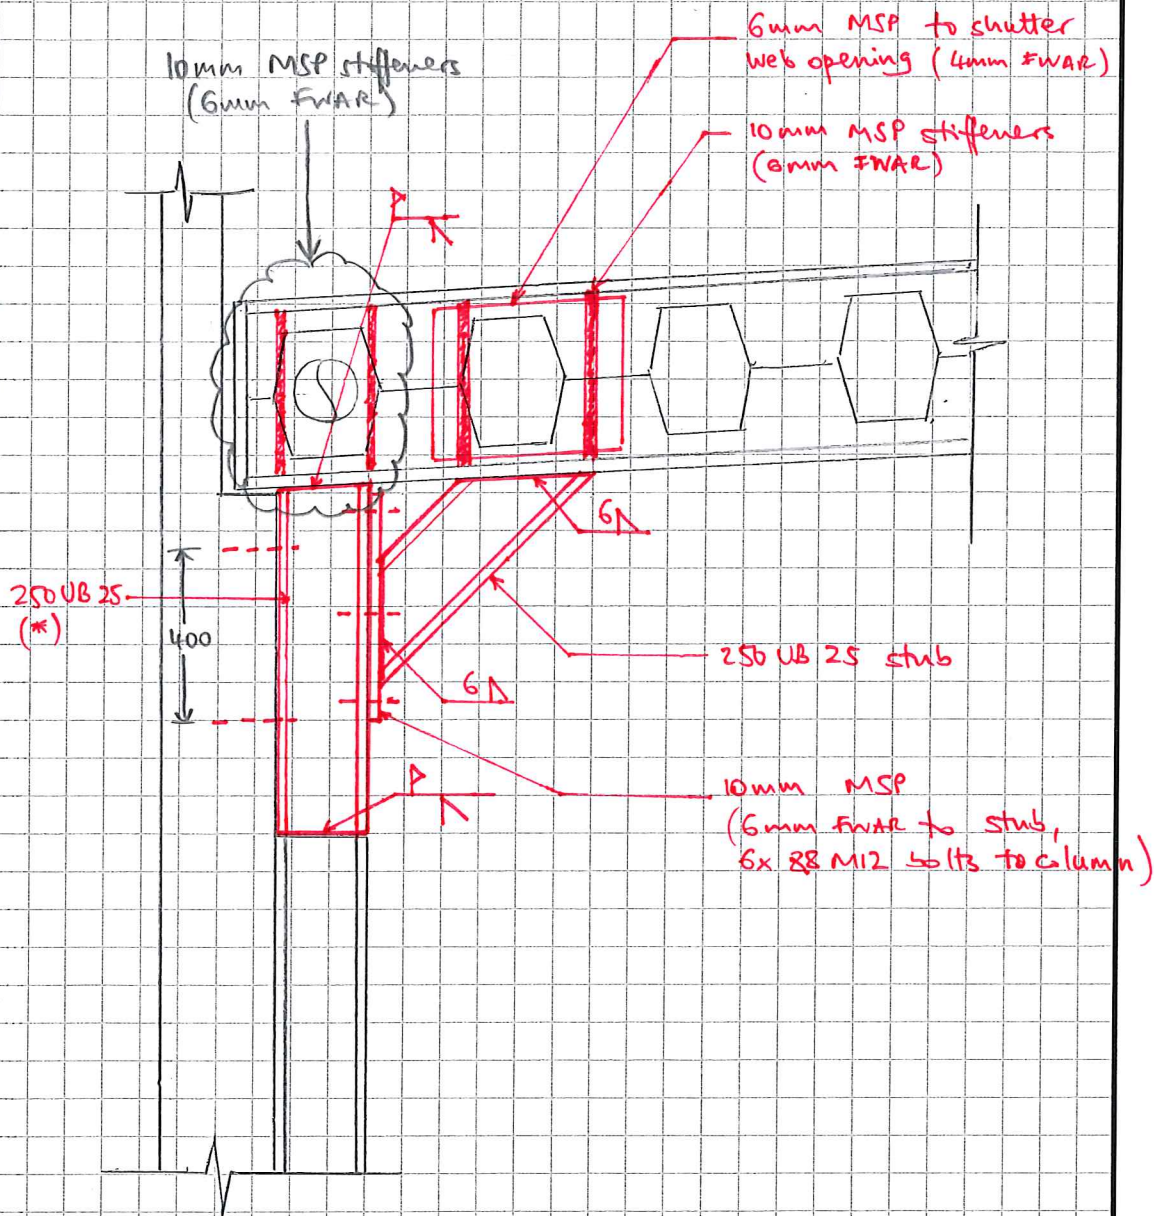

(*) connect to concrete column with
4x Hilti HIT-RE 500 V3 + HIT-V 8.8 M12 70mm embedment



DISCLOSURE STATEMENT

1. The following information has been supplied to Capital Commercial (2013) Limited ("Bayleys") to be made available for distribution on the vendor's behalf to potential purchasers to assist purchasers with their due diligence and to use at the purchaser's discretion.
2. Bayleys and the Vendor do not warrant the accuracy or completeness of the information and recommends that all recipients undertake their own due diligence, obtain their own reports to their satisfaction and seek independent advice prior to committing to purchaser.